
Technical Information Aquastop es sealing tape

BOSIG

Description:

Aquastop es sealing tapes are waterproof PE-coated, transverse stretching and longitudinally stable polypropylene membranes for sealing underneath ceramic coverings in damp and wet rooms (AIV-B). Aquastop es sealing tapes will cover and seal substrates and joints in walls and floors to prevent damage by moisture and water. Apply Aquastop es sealing tape in the course of regular floor and wall sealing work. With pressure "scaling".

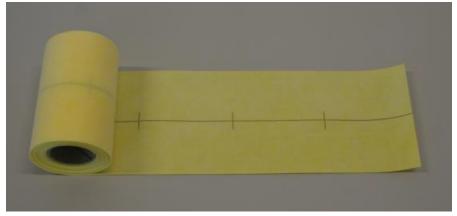

Aquastop es sealing tape is a component of the Aquastop sealing system. This comprises:

- Aquastop sealing membrane
- Aquastop es sealing tape
- Aquastop es inside corners
- Aquastop es outside corners
- Aquastop es sealing sleeves 65 140 mm (floor)
- Aquastop es sealing sleeves 15 35 mm (pipe feed-throughs)
- Aquastop es sealing sleeves 22 60 mm (pipe feed-throughs)
- C2 tile adhesive Sopro No. 1
- C2 tile adhesive CODEX Power CX3
- C2 tile adhesive PCI Flex Mortar S1
- MS polymer adhesive for overlaps Winflex TFS sealing adhesive
- MS polymer adhesive for overlaps Ottocoll M 500

Material properties:

Aquastop es sealing tapes comprise a polypropylene top and bottom membrane carrier with a modified polyethylene sealing layer.

Application:

Sealing tape for flexible sealing of joints in combination with tiles and flagstones – AIV-B, in Stress Classes A and C, general building supervisory test certificate no. P-1201/389/18-MPA BS.

Stress class	Stress	
А	Directly stressed wall and floor surfaces in areas subjected to frequent or extended servicing and cleaning with water, e.g. areas around swimming pools and showers (public and private).	
С	Wall and floor surfaces in areas subjected to very frequent or ongoing service and cleaning water (test media see general building supervisory test certificate no. P-1201/389/18-MPA BS), e.g. in commercia kitchens and laundries. Excluding areas classified under systems subjected to water-hazardous substances in terms of § 62 WHG [Federal Water Act].	



Technical data:

Colour		yellow other colours on request	
Total width		120 mm	
Overall thickness		other widths on request approx. 0.6 mm	
Material weight		approx. 231 g/m ²	
Thermal stability		- 30°C to + 90°C	
Length of roll		50 m	
Bursting pressure		max. 2.2 bar	internal
Max. tensile force	longitudinally	125 N / 15 mm	DIN EN ISO 527 – 3
	transverse	30 N / 15 mm	
Elongation at break	longitudinally	72%	DIN EN ISO 527 – 3
	transverse	252%	
Resistance to forces at 25% transverse stretch		0.60 N / mm	DIN EN ISO 527 – 3
Resistance to forces at 50% transverse stretch		0.80 N / mm	DIN EN ISO 527 – 3

Chemical stability:

Aquastop es sealing tape is resistant to many chemical fluids.

Application notes:

Substrate preparation:

The area of application of the sealing tape must be dry or moist, firm, stable, warp resistant and free of dust, dirt or release agents. Substrates must be pre-treated according to type, if necessary.

The substrate may deform only slightly after sealing. No cracks may exceed 0.2 mm after sealing.

Application: Sealing sheets, sealing tapes and system components must be cut to size and adjusted before application.

1. Sealing of edge or corner joints, transition of floor / wall and corners of walls:

After preparing the substrate, the outside and inside corners and then the sealing tapes will first be full surface glued to the floor / wall transitions and into the corners of walls. The seals must be centred on transitions or corners of walls. At least 50 mm sealing tape / sealing tape or sealing tape / inside or outside corner overlap is required. Winflex TFS sealing adhesive or Ottocoll M550 MS polymer adhesives should be used for gluing of overlaps (drying time will depend on the size and weight of further ceramic structures; normal tiling needs no specific drying time). Avoid air bubbles under system components. Wipe air bubbles to the outside using a smoothing trowel or slick-stone. Firmly press down the system components to achieve full surface adhesion. Spread excess adhesive along the bonding edge.

2. Sealing of surfaces:

To seal wall and then floor area surfaces, use a 4-tooth spatula to apply the C2 tile adhesive full surface, to manufacturer's instructions, including over the edges of the sealing tape fleece.

The sheets are then glued full surface. Lay the sheets up to the edges in transitions and corners, with the sealing membrane overlapping the sealing tape by 50 mm. Lay individual sheets onto the surfaces to overlap by at least 50 mm. Firmly press down the sealing membrane for full surface adhesion. Press down with a smoothing trowel and smooth away air bubbles by wiping towards the edges.



Use MS polymer sealing adhesive to full surface glue and thus caulk all sealing membrane / sealing tape and sealing membrane / sealing membrane overlaps. Spread excess adhesive along the bonding edges. Normal tiling requires no specific drying time. Ensure that sealing compounds in the overlapping area are applied according to manufacturer's instructions and that the coating is correspondingly dry.

Allow at least 2 hours for drying when working with particularly heavy tiles.

3. Sealing of penetrations, pipes, drains and installation parts:

Use MS polymer sealing adhesive to seal penetrations and installation parts and the corresponding floor and wall sleeves, ensuring full surface bonding to substrates (sealing membrane) and penetrations / installation parts. Use only floor drains with adhesive, loose or fixed flanges. Apply sealing adhesive to appropriately large areas using a 3-tooth applicator, then lightly press down the relevant wall or floor sleeve and smoothen. Spread excess adhesive along the bonding edges. Avoid enclosing air bubbles.

Notes:

When work is complete, check the entire sealed area for flaws or damage (e.g. perforations). Rework areas with punctures or uneven parts to ensure suitable sealing across the entire area.

Be careful when using new, sharp tools on sealing membranes, sealing tapes and system components. Such tools may damage sealing components and thus cause leakages!

Residual and waste material may be disposed of in residual waste / yellow drums or with packaging waste.

Storage:

Shelf life will be twelve months under conditions of perfect storage, i.e. covered and in the original packaging, and storage temperatures of 15 to 25°C and 40 to 60% humidity.

Attention! Important Note:

Due to the many possible applications of our products, we recommend subjecting the project to a thorough suitability test on original materials before release for further application.

Since our information are non-binding we do not warranty their correctness. For this reason we accept no liability for possible improper processing based on information submitted by our employees.

This technical data sheet replaces all previous versions and is valid until a new version is issued, or until Dec. 31, 2024. Please request the latest version after Jan. 01, 2025.

Dr. Hermann, Anwendungstechnik / Application Technology, Gingen / Fils

BOSIG GmbH

D - 73333 Gingen, Brunnenstraße 75 - 77

Telephone +49(0)7162-40 99-0 Telefax +49(0)7162-40 99-200

www.bosig.de info@bosig.de

Above information are based on best present knowledge of current technology, but do not guarantee faultless processing of our products. The information is based on practical results of our tests, but is not binding and does not constitute warranties of characteristics in terms of Federal Supreme Court jurisdiction. Our information does not constitute a legally binding assurance of certain properties or suitability for a specific purpose. Supplementary information by our specialists are merely recommendations, for which no liability is accepted.